



RS-232 自检操作 (RS-232 self operation)

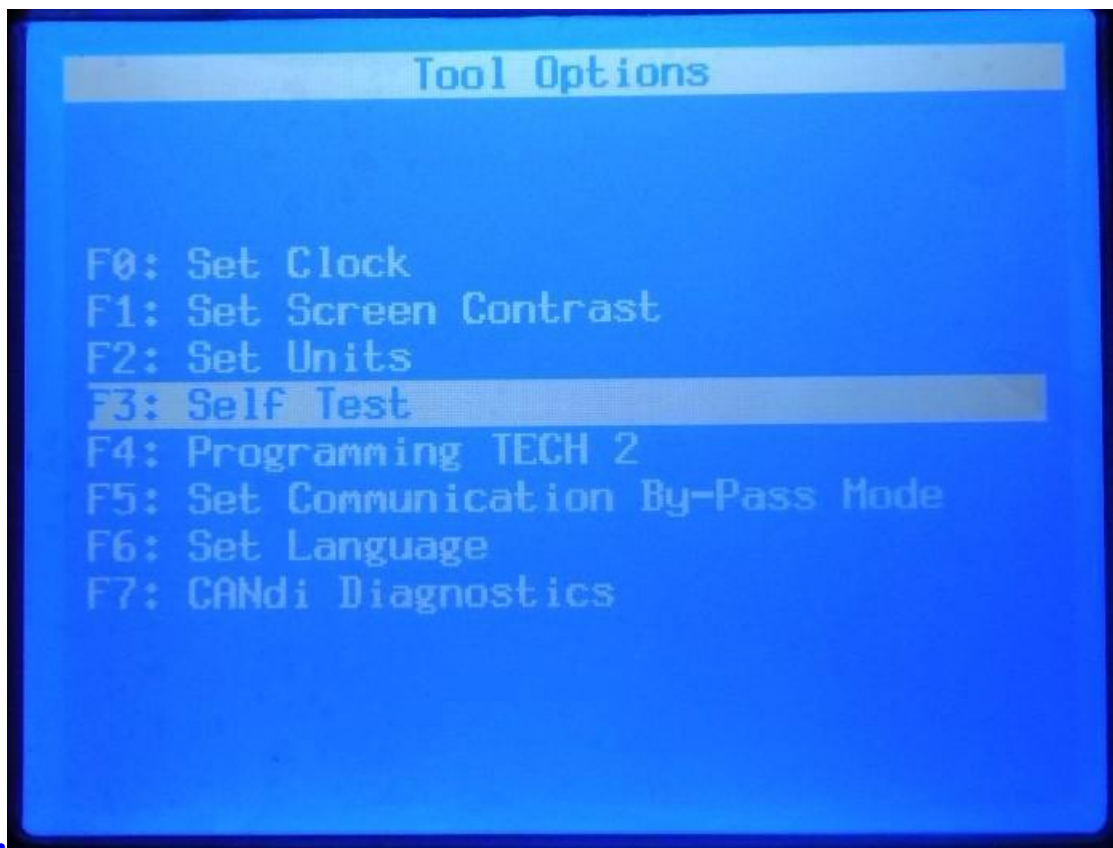

1.

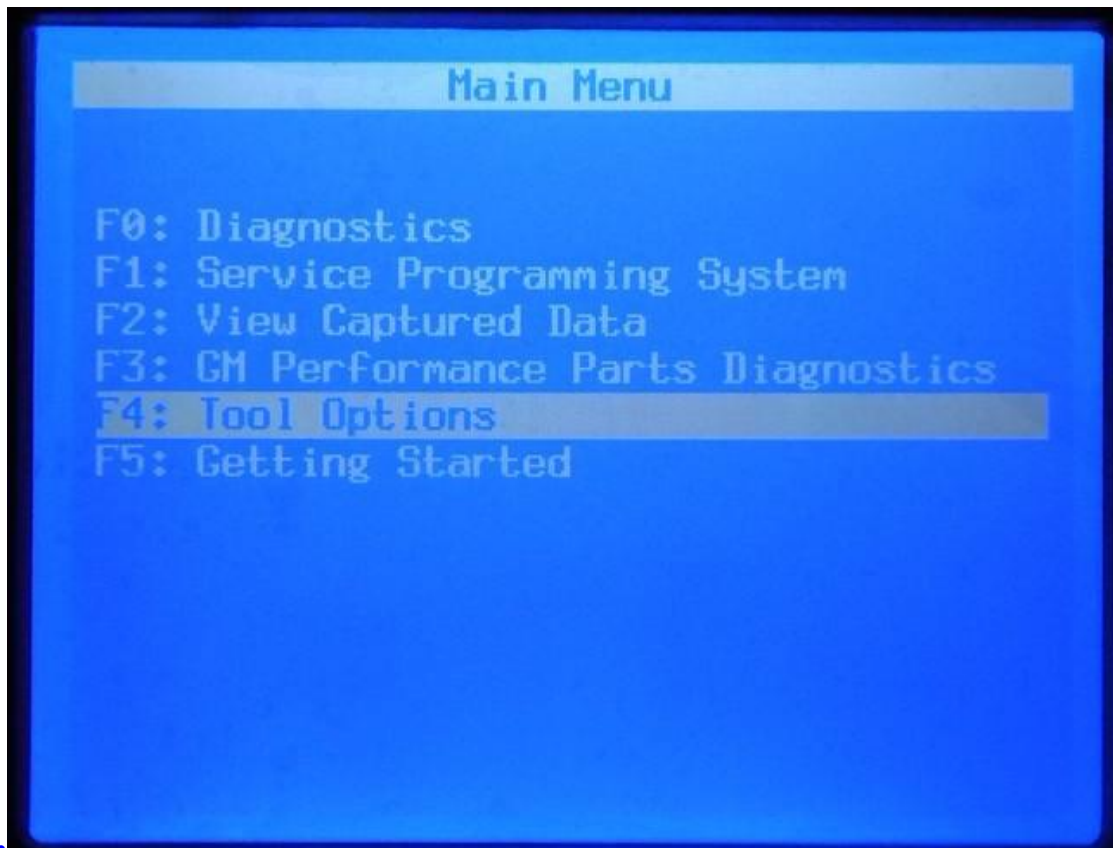

Before running the Tech 2 self test:

1. CANdi must not be connected.
2. ALDL loopback should be connected (GM3000109).
3. Failure to follow these instructions may invalidate the self test.

Press [EXIT] to continue

4.

Tech 2 Self Test
Version 6.40

- F0: Automated Main PCB and VCI
- F1: Automated Main PCB
- F2: Automated VCI
- F3: Selectable Main PCB**
- F4: Selectable VCI
- F5: Power On Self Test Results
- F6: Hardware ID

5.

